

1818 New York Avenue Suite 217 Washington, DC 20002 www.globalincusa.net

May 21, 2019

Prince Georges County Environmental Safety Office 13306 Old Marlboro Pike Upper Marlboro, MD 20772

Attention: Mr. Alex Baylor

RE: Indoor Air Quality Screening

Global Project Number: 19-015

School: Northview Elementary School

Dear Mr. Baylor,

On May 13, 2019, Global Inc.'s (GLOBAL) Certified Industrial Hygienist, Ms. Lauren Kesslak, conducted an Indoor Air Quality Screening at Northview Elementary School located at 3700 Northview Dr, Bowie, MD 20716.

#### Methodology

The IAQ evaluation included a visual assessment, sampling for non-viable mold spores in air, and measurement of comfort parameters (temperature, humidity, carbon dioxide, and carbon monoxide) in randomly selected representative locations within the building. During the visual assessment of representative locations, and when noted, GLOBAL documented those areas with suspected mold growth, water intrusions, and wet conditions that have the potential to lead to mold growth. GLOBAL also noted any unusual odors. At least one microbial air sample was collected for every 10,000 Square Feet (SF) of space in the building and the analytical results for the interior spaces were compared to an outdoor (ambient) sample collected on the same day.

Microbial samples (including a field blank for quality control) were delivered under strict chain-of-custody procedures were to Hayes Microbial Consulting - an AIHA EMPAT-certified laboratory in Midlothian, Virginia for analysis by microscopy. The sample chain-of-custody and laboratory report is attached.

#### **Observations and Results**

GLOBAL's inspector conducted a walkthrough with Prince Georges County Public School (PGCPS) personnel present. Rooms were selected in a random manner throughout the building so as to prevent sampling bias.



1818 New York Avenue Suite 217 Washington, DC 20002

www.globalincusa.net

#### Mold-in-Air Samples

There are no definitive regulations or standardized guidelines for addressing airborne mold in an indoor setting. If building systems (ventilation, envelope) are functioning properly, the indoor fungal ecology profile should be consistent with what is encountered outdoors and the spore concentrations should be below the ambient levels. Laboratory analytical results are attached at the end of this report.

### **Temperature**

The American Society of Heating, Refrigerating and Air-Conditioning Engineers (ASHRAE) have published recommendations for year-round acceptable temperatures in Standard 55-2016 (*Thermal Environmental Conditions for Human Occupancy*). The summer comfort range is 73 to 79°F. It is important to note that ASHRAE standards are intended as a suggested guideline as opposed to a regulation.

#### Relative Humidity (RH)

Relative humidity is a key factor for mold growth. Mold has the potential of growing on suitable surfaces with humidity levels above 60%. ASHRAE standard 62.1-2013 (*Ventilation for Acceptable Indoor Air Quality*) recommends a maximum indoor relative humidity of 65% to preclude the likelihood of condensation on cool surfaces encouraging mold growth. All the indoor relative humidity readings were below the ASHRAE recommended level of 65%.

#### Carbon Monoxide

Carbon monoxide (CO) is a colorless and odorless gas that is produced by the incomplete combustion of carbon-containing fuels. Oil, gasoline, diesel fuels, wood, coke, and coal are the major sources of CO. All registered CO concentrations were below the EPA National Ambient Air Quality Standard (NAAQS) of 9 ppm.

#### Carbon Dioxide

Under conditions of maximum occupancy, ASHRAE Standard 62.1-2013, Appendix C, infers that the acceptable carbon dioxide upper limit is the prevailing outdoor carbon dioxide concentration plus 700 parts per million (ppm). On May 9, 2019 the outdoor (ambient) carbon dioxide concentration was approximately 380.5 ppm so indoor concentrations should not exceed approximately 1080.5 ppm (700 + 380.5). All indoor carbon dioxide measurements were within the ASHRAE standards.

Observations are presented in Table 1 and testing results are presented in Table 2.

1818 New York Avenue Suite 217 Washington, DC 20002 www.globalincusa.net

**Table 1: Observations** 

Location	Observations
Library	No issues
150	No issues
221	No issues
203	No issues
336	No issues
328	No issues
300	No issues

**Table 2: Air Quality Results** 

Sample Location	Temp <sup>0</sup> F	RH%	CO ppm	CO2 ppm	Normal Fungal
Standards	ASHRAE 68 to 75°F	ASHRAE <65%	NAAQS <9	ASHRAE 1080.5	Ecology?
Ambient	52.1	51.2	0	380.5	N/A
Library	75	44	0	657	Yes
150	73.25	50.1	0	609	Yes
221	72.15	47.4	0	476.5	Yes
203	71.9	48.8	0	537.5	Yes
336	72	48	0	527.5	Yes
328	72.8	47.1	0	543.5	Yes
300	72.8	47.8	0	523.5	Yes



1818 New York Avenue Suite 217 Washington, DC 20002 www.globalincusa.net

# **Conclusions**

No indoor air quality issues related to mold were found during the screening performed on May 13, 2019, and all mold samples were found to have a normal ecology for an indoor environment.

It has been our pleasure to conduct these IAQ Screening services for the Prince Georges County Public School system. If you have any questions, please feel free to contact us.

Regards,

Lauren E. Kesslak, MS, CIH, CSP

Certified Industrial Hygienist

Lan E. Yould





Analysis Report prepared for

# Global, Inc.

1818 New York Ave. Suite 217 Washington, DC, 20002

Phone: (443) 691-0455

19-015 Northview ES

Collected: May 13, 2019 Received: May 14, 2019 Reported: May 14, 2019 We would like to thank you for trusting Hayes Microbial for your analytical needs! We received 8 samples by FedEx in good condition for this project on May 14th, 2019.

The results in this analysis pertain only to this job, collected on the stated date, and should not be used in the interpretation of any other job. This report may not be duplicated, except in full, without the written consent of Hayes Microbial Consulting, LLC..

This laboratory bears no responsibility for sample collection activities, analytical method limitations, or your use of the test results. Interpretation and use of test results are your responsibility. Any reference to health effects or interpretation of mold levels is strictly the opinion of Hayes Microbial. In no event, shall Hayes Microbial or any of its employees be liable for lost profits or any special, incidental or consequential damages arising out of the use of these test results.

Steve Hayes, BSMT(ASCP)
Laboratory Director

Hayes Microbial Consulting, LLC.

plan N. Hayes



EPA Laboratory ID: VA01419



Lab ID: #188863



NVLAP Lab Code: 500096-0



DPH License: #PH-0198

# Lauren Kesslak Global, Inc.

1818 New York Ave. Suite 217 Washington, DC, 20002 (443) 691-0455

# 19-015 Northview ES

#19019080

Spore Trap SOP - HMC#101

Sample Number	1	NWST/5	1319-01	2	NWST/5	1319-02	3	NWST/5	1319-03	4	NWST/5	1319-04	
Sample Name	Ambient				Library		150			221			
Sample Volume	75.00 liter				75.00 liter		75.00 liter			75.00 liter			
Reporting Limit		13 spores/m <sup>3</sup>			13 spores/m <sup>3</sup>		13 spores/m <sup>3</sup>				13 spores/m <sup>3</sup>		
Background		2		2			1			2			
Fragments		27/m <sup>3</sup>			ND			ND		ND			
Organism	Raw Count	Count / m <sup>3</sup>	% of Total	Raw Count	Count / m <sup>3</sup>	% of Total	Raw Count	Count / m <sup>3</sup>	% of Total	Raw Count	Count / m <sup>3</sup>	% of Total	
Alternaria													
Ascospores	144	1920	86.2%	2	27	100.0%	1	13	100.0%	1	13	25.0%	
Aspergillus Penicillium	1	13	<1%							1	13	25.0%	
Basidiospores	20	267	12.0%							2	27	50.0%	
Bipolaris Drechslera													
Chaetomium													
Cladosporium	2	27	1.2%										
Curvularia													
Epicoccum													
Fusarium													
Memnoniella													
Myxomycetes													
Pithomyces													
Stachybotrys													
Stemphylium													
Torula													
Ulocladium													
Total	167	2227	100%	2	27	100%	1	13	100%	4	53	100%	
Water Damage Indicator	r	Commo	n Allergen		Slightly Higher	than Baseline	Signi	ficantly Higher	than Baseline		Ratio Abnormal	ity	

HAYES
MICROBIAL CONSULTING

Collected: May 13, 2019

Project Analyst:

Ramesh Poluri, PhD

Received: May 14, 2019

Reported: May 14, 2019

Date:

**05 - 14 - 2019** s

Reviewed By: Steve Hayes, BSMT Date:

05 - 15 - 2019

# Lauren Kesslak Global, Inc.

1818 New York Ave. Suite 217 Washington, DC, 20002 (443) 691-0455

# 19-015 Northview ES

#19019080

Spore Trap SOP - HMC#101

Sample Number	5 NWST/51319-05			6	NWST/5	1319-06	7 NWST/51319-07			8 NWST/51319-08		
Sample Name	203				336		328			300		
Sample Volume		75.00 liter		75.00 liter		75.00 liter			75.00 liter			
Reporting Limit		13 spores/m <sup>3</sup>		13 spores/m <sup>3</sup>				13 spores/m <sup>3</sup>	}	13 spores/m <sup>3</sup>		
Background		2			2			3		2		
Fragments				13/m³			ND			ND		
Organism	Raw Count	Count / m <sup>3</sup>	% of Total	Raw Count	Count / m <sup>3</sup>	% of Total	Raw Count	Count / m <sup>3</sup>	% of Total	Raw Count	Count / m <sup>3</sup>	% of Total
Alternaria	Tian Count	Count / III	70 OI TOTAL	Tian odan	Jouint 7 III	- O O I TOTAL	Train Goalit	Journ 7 III	70 OT TOTAL	Tian Sounc	Journ 7 III	10 01 10141
Ascospores	1	13	20.0%	1	13	50.0%	1	13	33.3%	1	13	50.0%
Aspergillus Penicillium				1	13	50.0%						
Basidiospores	4	53	80.0%							1	13	50.0%
Bipolaris Drechslera												
Chaetomium												
Cladosporium							1	13	33.3%			
Curvularia							1	13	33.3%			
Epicoccum												
Fusarium												
Memnoniella												
Myxomycetes												
Pithomyces												
Stachybotrys												
Stemphylium												
Torula												
Ulocladium												
	_		3.000			1000			1000			
Total	5	66	100%	2	26	100%	3	39	100%	2	26	100%
Water Damage Indicator	r	Commo	n Allergen		Slightly Higher	than Baseline	Signi	ficantly Higher	than Baseline		Ratio Abnormal	ity

Collected: May 13, 2019

Project Analyst:

Ramesh Poluri, PhD

Received: May 14, 2019

Reported: May 14, 2019

Date:

05 - 14 - 2019

Reviewed By:

Steve Hayes, BSMT

Date:

05 - 15 - 2019

# Lauren Kesslak Global, Inc.


1818 New York Ave. Suite 217 Washington, DC, 20002 (443) 691-0455

# 19-015 Northview ES

#19019080

# **Spore Trap Information**

Reporting Limit	The Reporting Limit is the lowest number of spores that can be detected based on the total volume of the sample collected and the percentage of the slide that is counted. At Hayes Microbial, 100% of the slide is read so the LOD is based solely on the total volume. Raw spore counts that exceed 500 spores will be estimated.
Blanks	Results have not been corrected for field or laboratory blanks.
Background	The Background is the amount of debris that is present in the sample. This debris consists of skin cells, dirt, dust, pollen, drywall dust and other organic and non-organic matter. As the background density increases, the likelihood of spores, especially small spores such as those of Aspergillus and Penicillium may be obscured. The background is rated on a scale of 1 to 5 and each level is determined as follows:
	<ul> <li>NBD: No background detected due to possible pump or cassette malfunction. Recollect sample. (Field Blanks will display NBD)</li> <li>1: &lt;5% of field occluded. No spores will be uncountable.</li> <li>2: 5-25% of field occluded.</li> <li>3: 25-75% of field occluded.</li> <li>4: 75-90% of field occluded.</li> <li>5: &gt;90% of field occluded. Suggested recollection of sample.</li> </ul>
Fragments	Fragments are small pieces of fungal mycelium or spores. They are not identifiable as to type and when present in very large numbers, may indicate the presence of mold amplification.
Control Comparisons	There are no national standards for the numbers of fungal spores that may be present in the indoor environment. As a general rule and guideline that is widely accepted in the indoor air quality field, the numbers and types of spores that are present in the indoor environment should not exceed those that are present outdoors at any given time. There will always be some mold spores present in "normal" indoor environments. The purpose of sampling and counting spores is to help determine whether an abnormal condition exists within the indoor environment and if it does, to help pinpoint the area of contamination. Spore counts should not be used as the sole determining factor of mold contamination. There are many factors that can cause anomalies in the comparison of indoor and outdoor samples due to the dynamic nature of both of those environments.
Water Damage Indicator	Blue: These molds are commonly seen in conditions of prolonged water intrusion and usually indicate a problem.
Common Allergen	Green: Although all molds are potential allergens, these are the most common allergens that may be found indoors.
Slightly Higher than Baseline	Orange: The spore count is slightly higher than the outside count and may or may not indicate a source of contamination.  Red: The spore count is significantly higher than the baseline count and probably indicates a source of contamination.
Significantly Higher than Baseline	
Ratio Abnormality	Violet: The types of spores found indoors should be similar to the ones that were identified in the baseline sample. Significant increases (more than 25%) in the ratio of a particular spore type may indicate the presence of abnormal levels of mold, even if the total number of spores of that type is lower in the indoor environment than it was outdoors.
Color Coding	Fungi that are present in indoor samples at levels lower than 200 per cubic meter are not color coded on the report, unless they are one of the water damag indicators.

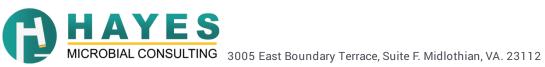

# Lauren Kesslak Global. Inc.

1818 New York Ave. Suite 217 Washington, DC, 20002 (443) 691-0455

### 19-015 Northview FS

#19019080

# **Organism Descriptions**

Ascospores

A large group consisting of more than 3000 species of fungi. Common plant pathogens and outdoor numbers become very high following

rain. Most of the genera are indistinguishable by spore trap analysis and are combined on the report.

Effects:

Health affects are poorly studied, but many are likely to be allergenic.

Aspergillus | Penicillium

The most common fungi isolated from the environment. Very common in soil and on decaying plant material. Are able to grow well indoors on Habitat:

a wide variety of substrates.

Effects: This group contains common allergens and many can cause hypersensitivity pneumonitis. They may cause extrinsic asthma, and many are

opportunistic pathogens. Many species produce mycotoxins which may be associated with disease in humans and other animals. Toxin

production is dependent on the species, the food source, competition with other organisms, and other environmental conditions.

**Basidiospores** 

Habitat: A common group of Fungi that includes the mushrooms and bracket fungi. They are saprophytes and plant pathogens. In wet conditions they

can cause structural damage to buildings.

Common allergens and are also associated with hypersensitivity pneumonitis. Effects:

Cladosporium

One of the most common genera worldwide. Found in soil and plant debris and on the leaf surfaces of living plants. The outdoor numbers are Habitat:

lower in the winter and often relatively high in the summer, especially in high humidity. The outdoor numbers often spike in the late afternoon

and evening. Indoors, it can be found growing on textiles, wood, sheetrock, moist window sills and in HVAC supply ducts.


Effects: A common allergen, producing more than 10 allergenic antigens and a common cause of hypersensitivity pneumonitis.

Curvularia

Habitat: They exist in soil and plant debris, and are plant pathogens.

Effects: They are allergenic and a common cause of allergic fungal sinusitis. An occasional cause of human infection, including keratitis, sinusitis,

onychomycosis, mycetoma, pneumonia, endocarditis and desseminated infection, primarily in the immunocompromised.

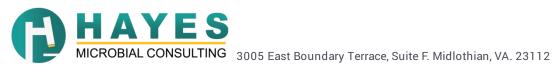



Job Number: 19-015

Olobal Inc. Company:

Job Name: Northview ES

Address:

Snik 217, Washington, DC 20002

SHIP: FEDEX - PAK 50 DATE: 05-14-2019

MOLD

0102 2311 2840 0577

Collector: L. I	Kesslak			IVIUDI		19105	Email: LaurenK@globalincusa.net		
Date Collected:		1	2	Note					
Analysis		Ti	ırnaround		Accepted Media Types				
Spore Trap	S	Identification & Enumeration of Fungal Spores		24 1	24 Hour Air Cassettes, Impact Slides				
	S+	Spore Trap Analysis with Dander, Fiber, and Pollen	counts	24 1	ettes, Impact Slides				
Direct ID	D	ID & Semi-Quantative Enumeration of spores and n	nycelium	24 1	Hour	e, Tape, Swab, Bulk, Agar Plate			
	D+	Direct Analysis with Fully Quantitative spore count	t	24 Hour Bio-Tape,			Tape, Tape, Swab, Bulk, Agar Plate		
Culture	C1	Identification & Enumeration of Mold only		7 D	ay	Air Plate, Agar Plate, Swab, Bulk			
	C2	Identification & Enumeration of Bacteria only		4 D	ay	, Agar Plate, Swab, Bulk			
	C3 Identification & Enumeration of Mold and Bacteria				ay	Air Plate, Agar Plate, Swab, Bulk			
	C5	Coliform Screen for Sewage Bacteria		2 Da	ay	Agar Plate, Swab, Bulk			
Particle TPA Total Particulate Analysis, ID & Count (Does Not Include Mold)				24 Hour		Air Cassettes, Impact Slides, Bio-Tape			
#	Number ,	Sample	Ana	lysis	Volume		Notes		
1 M	VES+51319-0	Ambient	5	1	754				
2	1 02	150 Library	Y		1				
2	di	150	9						

#	Number	/		Volume	Notes
1	WES+51319-01	Ambient	3.1	754	
2	/ Z	150 Library			
3	03	150			
4	24	221			
5	03	203			
6	UÇ	336			
7	, 17	328	1		
8	V 08	Enfe CV 5 300	A	V	
9					
0	V				
1					
2	3"				
3					
4					
5					
6			7		

Released by:

Received By:

Date:

Hayes Microbial Consulting, LLC.

3005 East Boundary Terrace, Suite F. Midlothian, VA. 23112

(804) 562-3435

contact@hayesmicrobial.com

Form #20, Rev.3, March 23, 2019 Chain of Custody